

What is wrong with this coated girth weld?

